

SERVICE BULLETIN

**Subject: Ceronix Overhead Monitors -
AC Power Receptacle - 57-301032-000**

Date: 7/21/04

Distribution: Frameworkx & Vector Scorer Customers

Bulletin No. SB04-6

It has come to our attention that the AC power module from Delta Electronics, (refer to Figure 1), is being manufactured with the fuse connector clips spread open too wide for the fuse. Refer to Figure 2.

The failure from this defect is intermittent power loss to the overhead monitors.

In order to prevent this:

1. Remove the power plug from the power module.
2. Remove the fuse holder block. Refer to Figure 3.
3. Squeeze the fuse connector clips together so that they make a solid connection with the fuse. Refer to Figure 4.



FIGURE 1

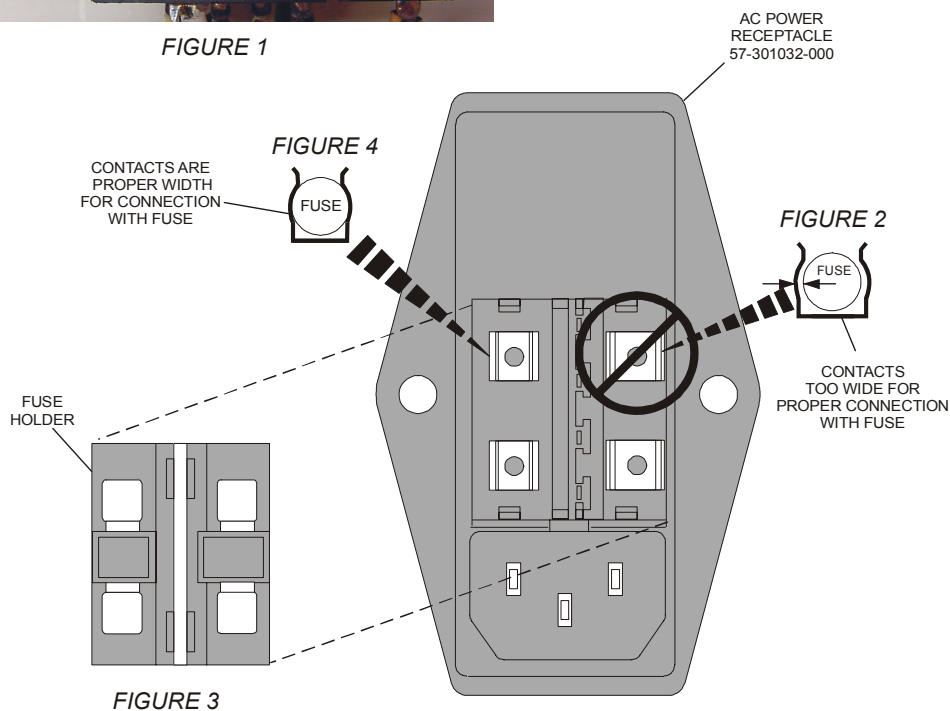


FIGURE 3

Kord L. Daniels
Kord L. Daniels
Service Product Engineer

David E. Rice
David E. Rice
Director of Worldwide Service