

SERVICE BULLETIN

Subject: A-2 Magnetic Clutch Power Plug Issue

Date: 11/06/17

Bulletin No. SB17-3

It has come to Brunswick's attention that part number 12-862163-000 Magnetic Clutch Power Plug, may be incorrectly assembled.

Please verify the terminals connections of the magnetic clutch.

Make sure that the clutch cables are secured between the metal plates in the plug and not toward the clear plastic part. Incorrect wiring may cause the magnetic clutch not to function as intended.

To speak with a Brunswick sales representative, call 1-800-937-2695, select option 2, then option 3 or visit our website at <http://www.brunswickbowling.com/contact/sales-rep>.

If you have questions regarding the information contained in this Service Bulletin, please contact Brunswick Technical Support at 1-800-937-2695 or 1-231-725-4966, FAX 231-725-4667, or email techsupport@brunswickbowling.com.

Visit <http://brunswickbowling.com/service-support/tech-support/> for electronic files of this and other service bulletins.

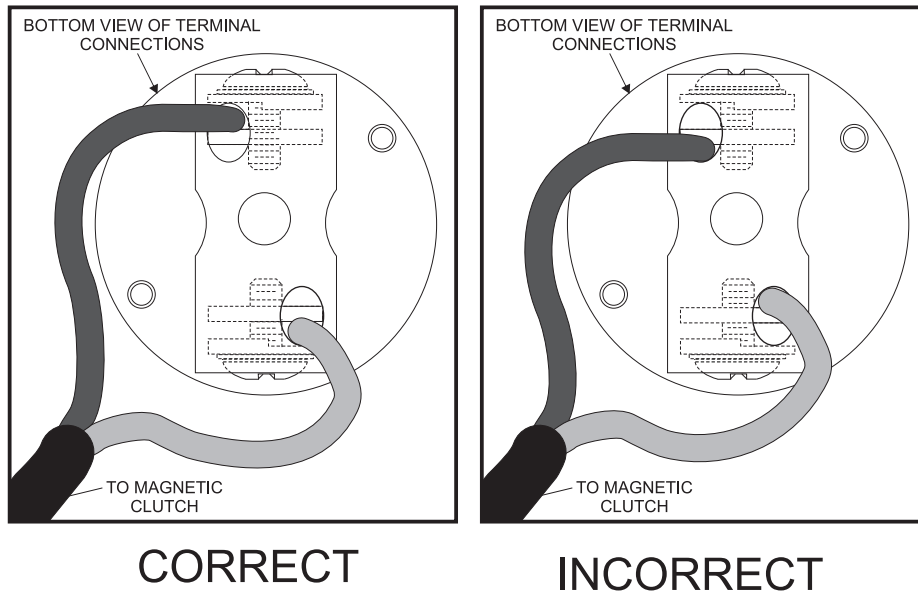


Figure 1



Hector R. Cuyar
Brunswick Technical Support



William P. Jager
Training & Publications Manager